

## **USING THE HIGHWAY SAFETY RESEARCH CENTER CHILD RESTRAINT RECALL LIST**

**Last Revision: November 21, 2007**

### **About Child Restraints and Recalls**

It is very important to pay attention to recall notices and for parents to check if their seats are safe to use or if they need to be repaired or replaced. Recalls can be issued for any failure to meet Federal Motor Vehicle Safety Standard 213 established and enforced by the National Highway Traffic Safety Administration (NHTSA). Many recalls are issued due to reasons related to the crashworthiness of the child restraint, but some recalls are for deviations from the standards relating to labeling requirements, flammability of the upholstery or padding, or for parts that may come loose and pose a choking hazard.

Child restraints (CRs) are required to have a label indicating the manufacturer, model information, and date of manufacture. If the label is missing on a child restraint, the manufacturer should be contacted to see if the CR can be identified through other information. CRs should not be used if the model name, number, and date of manufacture cannot be determined.

Child restraint manufacturers have supplied registration cards with each new seat since 1993. It is important for the user to complete the registration card and send it to the manufacturer for quick notification in the event of a recall or safety notification. If the card for a restraint has been lost or if it was made before 1993, it can be registered by contacting the manufacturer through the phone numbers provided in the instructions and on the label on the seat.

Some recall notices are related to problems that do not make the restraints unsafe in a crash, but all problems should be corrected. Phone numbers are provided on the recall list when a corrective action can be taken. The manufacturer should be able to advise the parent whether to continue using the current restraint or to obtain another one until the problem can be corrected.

In cases where the manufacturer has gone out of business or discontinued replacement programs, parents are advised to destroy the seat and use another one. Unsafe seats should NOT be thrown in the trash where they can be picked up and used by others. Discarded seats should be destroyed by having them crushed. At the least, they should be taken apart and stripped of upholstery, padding and straps to prevent others from using them.

To report any suspected child restraint or vehicle safety defects, call the National Highway Traffic Safety Administration Auto Safety Hotline at 888-327-4236.

### **About Older Child Restraints and Recalls**

Child restraints manufactured before 1981 were not required to be crash tested and must not be used. Most child passenger safety advocates recommend that CRs older than ten years should be replaced by a new one. Note that some manufacturers and safety advocates recommend replacing CRs before 10 years and some child restraints are stamped with an expiration date. Parents and other caregivers are encouraged to contact the child restraint manufacturer for model specific recommendations.

Older models, those manufactured since 1981, are included as a part of the HSRC recall list because parents and other care givers will sometimes choose to use child restraints older than ten years even though it goes against the recommendations of most organizations and advocates. Knowing that a particular model is under recall, and if the defect can be corrected, should help to encourage the care giver to destroy the older CR and obtain a new one.

**About the HSRC Recall List**

The UNC Highway Safety Research Center (HSRC) child restraint (CR) recall list identifies recalls and safety notifications for child restraint systems known by the HSRC at the time it is published and is updated by HSRC as soon as possible after recall notifications are announced. Users of this list can sign up for automatic email notification of updates to the HSRC recall list through the HSRC website at: [http://www.hsrc.unc.edu/pubinfo/child\\_recall\\_email.htm](http://www.hsrc.unc.edu/pubinfo/child_recall_email.htm).

The HSRC recall list is formatted in a relatively compact format without much detail, but does serve to indicate if a particular model has been recalled. Users of this list are encouraged to obtain more detailed information about recent recalls through the "Most Recent Car Seat Recall Announcements and Notices" page of the HSRC website at: [http://www.hsrc.unc.edu/pubinfo/child\\_recallrelease.htm](http://www.hsrc.unc.edu/pubinfo/child_recallrelease.htm).

The HSRC recall list is formatted with older models being separated from newer models. Recalls for models of child restraints where most or all of the effected units are 10 years old or older appear at the end of the list. A separate index for the older models precedes the list. The listing of older models with recalls will only be updated as "newer" models get to be old enough to be moved to the "older" models list.

The index listing numbers and page numbers for the older models section will stay the same until the older model section is updated or otherwise revised. Programs that make multiple copies of the list, e. g., for use at clinics or permanent checking stations, should only have to make copies of the older model section when it is revised regardless of how often the main (newer model) section is revised.

**Instructions for Using the PDF Version of the HSRC Recall List**

Find the manufacturer, model name, model number, and date of manufacture on the label of the child restraint itself. Using this information:

- Look to see if the manufacturer and model name and/or model number are listed in the index. NOTE: Child restraints under recall are listed in the index by both model name and model number. Each entry on the list and in the index is assigned a "List #" based on its location in the list alphabetized by manufacturer and model name. List #'s for individual models will change in subsequent lists as models are added to or removed from the list.
- If that model name or model number is listed in the index, note the "List # (number)" and use the List # to locate the recall information for that model. Once located, check to see if the date range for the recall includes the date of manufacture listed on the label of the child restraint.
- If the restraint is included in the recall, the CR manufacturer should be contacted for verification of the recall and steps to take to correct the problem.
- If the manufacturer has gone out of business or discontinued their repair or replacement program, the CR should be destroyed after a replacement restraint is obtained.
- If the restraint is not included in the recall, inform the parent of this but still refer the parent to the manufacturer for verification of the restraint's recall status and to make sure it is registered with the manufacturer in case there is a recall issued on it in the future.

For further information, contact:

Bill Hall

The University of North Carolina Highway Safety Research Center

CB# 3430

Chapel Hill, NC 27599

919-962-2202 or (in NC) 800-672-4527 or [bill\\_hall@unc.edu](mailto:bill_hall@unc.edu)

The following lists identify recalls and safety notifications for child restraints (CRs) known by the UNC Highway Safety Research Center (HSRC) as of November 21, 2007. This list is updated by HSRC as soon as possible after recall notifications are announced. Updated versions are available on-line at [www.hsrc.unc.edu](http://www.hsrc.unc.edu) or by phone at 919-962-2202 or 800-672-4527 (in NC). The most recent addition(s) to the list is/are denoted by ">>".

CRs are required to have labels indicating the manufacturer, model name and number, and date of manufacture. Model names and numbers are listed for most of the recalls. Model numbers followed by one or more "x" should be read as "model numbers beginning with." If the label is missing on your CR, contact the manufacturer to see if it can be identified through other information. **A CR should not be used if its recall status cannot be determined because the model name, model number, date of manufacture or manufacturer is not available.**

CRs manufactured before 1981 were not required to be crash tested and must not be used. Most child passenger safety advocates recommend that CRs older than ten years should be replaced by a new one. Note that some manufacturers and safety advocates recommend replacing CRs before 10 years. **Models older than ten years and under recall are included on a separate list with a separate index.** The index for older models can be found following the last page of the "Models Less Than 10 Years Old" recall list and the list of older models with recalls follows the second index. **The "Models At Least 10 Years Old" list was last revised August 23, 2007.**

Some of the recalls/notifications for CRs on this list may be more or less date- or lot-specific than what is listed. More detailed information should be obtained through the manufacturer and **it is the manufacturer who can and should make the final determination if a specific CR is subject to recall.**

Some of the recall notices are related to problems that do not make the seats unsafe in a crash, but **all problems should be corrected.** Phone numbers are provided when a corrective action can be taken. The manufacturer should advise you whether to continue using your current CR or to obtain another one until the problem can be corrected.

**In cases where the manufacturer has gone out of business or discontinued replacement programs, you are advised to destroy the CR and obtain and use another one as soon as possible.** Do not throw unsafe models in the trash where they can be picked up and used by others. Discarded CRs should be destroyed by having them crushed. At the least, they should be taken apart and stripped of upholstery, padding and straps to prevent others from using them.

To report any suspected safety seat or vehicle safety defects, contact the National Highway Traffic Safety Administration Auto Safety Hotline: (888) 327-4236.

## CHILD RESTRAINTS LESS THAN 10 YEARS OLD

### Index of Recalls and Safety Notifications

Model numbers (noted by a "#") and model names for child restraints under recall are followed by their list number (that corresponds to the "List #" for each listing). Model numbers followed by an "x" should be read as "model numbers beginning with." If the model # is not found, check the model name also. Model #'s are not available for all model names.

<b>Alcot</b>	<b>Basic Comfort</b>	<b>Buckle-Up Harness</b> . . . . . 11	# E9L57 . . . . . 13
ALL MODELS . . . . . 1	# 960 . . . . . 8, 9		# E9L80 . . . . . 15, 16
	# 961 . . . . . 8, 9	<b>Britax</b>	# E9W06 . . . . . 21
<b>All Our Kids</b>	Galaxy 2000 . . . . . 8, 9	# 161 . . . . . 26	Advantage . . . . . 12
ALL MODELS . . . . . 2		# E902228 . . . . . 12	Boulevard . . . . . 13
<b>Alpha Elite (Dorel)</b>	<b>Beatrix Potter (Dorel)</b>	# E9031 . . . . . 24, 25	Companion . . . . . 14, 15, 16
# 22331 BLA . . . . . 3, 4	# 02-620-AZY . . . . . 10	# E906 . . . . . 21	Decathlon . . . . . 17
# 22332 RLA . . . . . 3, 4	# 02-620-BEA . . . . . 10	# E9L06 . . . . . 21	Husky . . . . . 18, 19
Comfort Infant Seat . . . . . 3, 4	# 02-621-SAL . . . . . 10	# E9L07 . . . . . 28	Marathon . . . . . 20, 21
	Designer 22 . . . . . 10	# E9L14 . . . . . 14, 15, 16	Regent . . . . . 22, 23
<b>American Motors</b>	<b>Bolform</b>	# E9L20 . . . . . 15, 16	Roundabout . . . . . 26
ALL MODELS . . . . . 5	ALL MODELS . . . . . 7	# E9L30 . . . . . 18, 19, 20	Super Elite . . . . . 24, 25
<b>Babyhood Industries</b>	<b>Bolform Corp.</b>	# E9L32 . . . . . 27	Traveller Plus . . . . . 27
ALL MODELS . . . . . 6	# 84E-019 . . . . . 11	# E9L3998 . . . . . 22	Wizard . . . . . 28
		# E9L39x . . . . . 23	
		# E9L47 . . . . . 17	

<b>Century</b>		<b>Compass Baby</b>		<b>Downunder</b>			
# 12-565	34	# I420 ARD	39	Kangaroo Booster	49	# 493x	61
# 44612	33	# I420 FUO	39			# 499x	62
# 44622	30	# I420 MAR	39	<b>Eddie Bauer</b>		# 540xx	60
# 44630	30	Infant Car Seat	39	# 02-331	50	# 548xx	60
# 44631	30			# 02-332	50	# 549xx	60
# 44662	30	<b>Cosco</b>		# 02-531	50	# 550xx	60
# 44709	35	# 02-331	40	# 02-533	50	# 556xx	60
# 45100	29	# 02-332	40	# 02-537	50	# 597xx	60
# 4513	34	# 02-531	40	# 02-555	50	# 598xx	60
# 4515	34	# 02-533	40	# 22-625 AFD GB1B	57	# 599xx	60
# 4516	34	# 02-537	40	# 22-625 EDG GB1B	57	# 636x	68
# 4518	34	# 02-665	43	# 22-625 GLC GB1B	57	# 637x	68
# 45200	29	# 02-667	47	# 22-625 MAC GB1B	57	# 639001	63
# 4551	34	# 02-727	43	# 22630 AFD	53, 54	# 639002	63
# 4557	34	# 02-728	43	# 22630 BAL	53, 54	Cozy Carry	59
# 4558	34	# 02-729	43	# 22630 FTM	53, 54	Embrace	60
# 4559	34	# 02-729 TED	42	# 22630 HPN	53, 54	Joyride	61
# 45600	29	# 02-731	43	# 22630 LKM	53, 54	On My Way	62
# 4564	34	# 02-732	43	# 22630 LRS	53, 54	On My Way base	63
# 4565	34	# 02-733	43	# 22631 LNG	53, 54	Travel Tandem	64
# 4566	34	# 02-750	43			Tribute	65
# 4568	34	# 02-751	43	# 22740	58	Triumph	66, 67
# 4569	34	# 02-753	47	# 22750	52	Two-in-One	68
# 45700	29	# 02-755	43	# 22755	52		
# 4575	34	# 02-756	43, 47	# 22756	52	<b>Fisher Price</b>	
# 4576	34	# 02-757	43	# 22757	52	# 79700	69
# 4589	34	# 02-758	47	# 22770	52	Safe Embrace	69
# 4591	34	# 02-759	47	3-in-1	50, 51		
# 4593	34	# 02-760	47	Alpha Omega	52	<b>Ford [Aftermarket]</b>	
# 4594	34	# 02-761	47	Alpha Omega Elite	52	ALL MODELS	70
# 4595	34	# 02-762	47	Comfort Infant Seat	53, 54		
# 4597	34	# 02-763	47	Deluxe 3-in-1	55	<b>Ford [Integrated]</b>	
# 4662	33	# 02-764	47	Deluxe Convertible	56	Windstar	121
# 4875	31	# 02-765	47	Designer 22	57		
# 4885	32	# 02-770	47	Enspira	58	<b>General Motors [Aftermarket]</b>	
Accel	29	# 02-771	47			ALL MODELS	71
Bravo	30	# 02-772	47	<b>Evenflo</b>			
Breverra Contour	31	# 02-774	43	# 200x	62	<b>Gerry</b>	
Breverra Premiere	32	# 22-001FSM	45	# 203x	61	ALL MODELS	72
Encore	33	# 22-297	46	# 205x	61, 64		
Infant Car Seat	34	# 22-298	46	# 210x	61, 64	<b>Graco</b>	
Smart Move	35	# 22-299	46	# 211x	62	# 7493	73
		# 22-300-JOS GB1B	44	# 264x	66, 67	# 7497	73
<b>Childcare</b>		# 22150	41	# 272x	59	# 7499	73
ALL MODELS	1	# 22155	41	# 273x	59	# 8402	74
		# 22180	41	# 317xx	60	# 8402L	74
<b>Chrysler [Aftermarket]</b>		# 22269	41	# 320xx	60	# 8403x	74
ALL MODELS	36	Alpha Omega	40, 41	# 359x	66	# 841101	73
		Alpha Omega Elite	41	# 378x	65	# 841102	73
<b>Chrysler [Integrated]</b>		Arriva	40, 42, 43	# 379x	65	# 841103	73
Town and Country	113, 114, 115, 116	Designer 22	44	# 389x	66	# 8412	74
		DreamRide	45	# 397xx	60	# 841203	73
		High Rise Booster	46	# 398xx	60	# 8412T02	73
<b>Collier-Keyworth</b>		Turnabout	47	# 435x	61	# 8433x	76
ALL MODELS	37	Voyager Inf/Stroller	48	# 447x	62	# 8442x	74
				# 468x	59	# 8443	74
<b>Combi</b>		<b>Dodge [Integrated]</b>		# 469x	59	# 8443L	74
# 8100	38	Caravan	117, 118, 119, 120	# 476x	59	# 8444	74
Avatar	38	Grand Caravan	117, 118, 119, 120	# 477x	59	# 8444L	74
				# 478x	59	# 8446	74
				# 480x	59	# 8446L	74
				# 481x	59	# 8447	74

<b>Graco (continued)</b>		<b>Plus 4</b> . . . . . 82	<b>Safeline Kids</b>	
# 8447L . . . . . 74		<b>Plus 5</b> . . . . . 83	# 2003 . . . . . 97	
# 8448 . . . . . 74		<b>Secura</b> . . . . . 84	# 2240 . . . . . 98	
# 8448L . . . . . 74		<b>Travel-About</b> . . . . . 85	# 3240 . . . . . 99	
# 8457 . . . . . 73, 74			<b>Sit'n'Stroll</b> . . . . . 97, 98, 99	
# 8458 . . . . . 73, 74		<b>Lin Lih/MCP</b>		
# 8459 . . . . . 73, 74		<b>ALL MODELS</b> . . . . . 86	<b>Safety 1st (Dorel)</b>	
# 8460 . . . . . 73			# 02-620-AZY . . . . . 103	
# 8462 . . . . . 73		<b>Mercedes-Benz</b>	# 02-620-BEA . . . . . 103	
# 8463x . . . . . 74		# B66868203 . . . . . 89	# 02-621-SAL . . . . . 103	
# 8464 . . . . . 74		# B66868204 . . . . . 89	# 22-325 CMB GB1B . . . . . 104	
# 8470 . . . . . 74		# B66868209 . . . . . 89	# 22-325 DTA GB1B . . . . . 104	
# 8471 . . . . . 73, 74		# BQ6910155 . . . . . 88	# 22-325 TST GB1B . . . . . 104	
# 8472 . . . . . 73		# BQ6910157 . . . . . 87	# 22-325 VIN GB1B . . . . . 104	
# 8473 . . . . . 73		# BQ691063 . . . . . 87	# 22151 . . . . . 101	
# 8474 . . . . . 73		<b>Booster Seat</b> . . . . . 87	# 22450 . . . . . 106	
# 8476 . . . . . 73		<b>Infant Restraint</b> . . . . . 88	# 22451 . . . . . 106	
# 8477 . . . . . 73		<b>Kiddy TopSafe</b> . . . . . 89	# 22452 . . . . . 106	
# 8478 . . . . . 73, 74			# 22453 . . . . . 106	
# 8601 . . . . . 74		<b>Mia Moda</b>	# 22455 . . . . . 101	
# 8602x . . . . . 74		# 5000 . . . . . 90	# 22460 . . . . . 105	
# 8603M . . . . . 74		# 5001 . . . . . 90	# 22480 . . . . . 106	
# 8605x . . . . . 74		<b>Viva</b> . . . . . 90	# 22481 . . . . . 106	
# 8607x . . . . . 74			<b>Alpha Elite</b> . . . . . 100	
# 8608D . . . . . 74		<b>Peg Perego</b>	<b>Alpha Omega</b> . . . . . 101	
# 8609x . . . . . 75		# AL33USL . . . . . 92	<b>Alpha Omega Elite</b> . . . . . 101	
# 8616x . . . . . 75		# AL33USN . . . . . 92	<b>Alpha Sport</b> . . . . . 102	
# 8629x . . . . . 76		# AL34USL . . . . . 92	<b>Designer 22</b> . . . . . 103, 104	
# 8630x . . . . . 76		# AL34USN . . . . . 92	<b>Enspira</b> . . . . . 106	
# 8631x . . . . . 76		# CS00MU1 . . . . . 91, 92	<b>Intera</b> . . . . . 105	
# 8632x . . . . . 76		# CS00US1 . . . . . 91, 92		
# 8635x . . . . . 76		# CS00US8 . . . . . 91, 92	<b>Snug Seat</b>	
# 8639x . . . . . 76		# LN34S09 . . . . . 92	# 200-1000 . . . . . 107	
# 8643x . . . . . 75		# LN34S10 . . . . . 92	# 600-1000 . . . . . 108	
# 8645x . . . . . 75		# LV34USL . . . . . 92	# E9L32 . . . . . 109	
# 8646x . . . . . 75		# LV34USN . . . . . 92	<b>Gorilla</b> . . . . . 107	
# 8C00x . . . . . 76		# ST33USL . . . . . 92	<b>Spelcast</b> . . . . . 108	
# 8C01x . . . . . 76		# ST33USN . . . . . 92	<b>Traveller Plus</b> . . . . . 109	
# 8C02x . . . . . 76		# ST38USL . . . . . 92		
# 8C03x . . . . . 76		# ST38USN . . . . . 92	<b>Strolee</b>	
# 8C04x . . . . . 76		<b>Primo Viaggio</b> . . . . . 91, 92	<b>ALL MODELS</b> . . . . . 110	
# C844342 . . . . . 74				
<b>ComfortSport</b> . . . . . 76		<b>Playskool</b>	<b>TRW</b>	
<b>SnugRide</b> . . . . . 73, 74, 75		# 77005 . . . . . 93	<b>ALL MODELS</b> . . . . . 111	
		# 77007 . . . . . 93		
<b>International</b>		<b>Infant Car Seat</b> . . . . . 93	<b>XSCi</b>	
<b>ALL MODELS</b> . . . . . 77			<b>Pioneered ACIS</b> . . . . . 112	
<b>Kolcraft</b>		<b>Plymouth [Integrated]</b>		
# 1312x . . . . . 80		<b>Grand Voyager</b> . . . . . 122, 123, 124, 125		
# 1382x . . . . . 80, 82, 83, 85		<b>Voyager</b> . . . . . 122, 123, 124, 125		
# 1383x . . . . . 78, 80, 82, 83, 85				
# 1384x . . . . . 82, 83, 85		<b>Pride Trimble/Virco</b>		
# 1385x . . . . . 83, 85		<b>ALL MODELS</b> . . . . . 94		
# 368xx . . . . . 80, 82, 83				
# 43xxx . . . . . 79, 84		<b>Questor</b>		
# 77005 . . . . . 81		<b>ALL MODELS</b> . . . . . 95		
# 77007 . . . . . 81				
<b>Infant Car Seat</b> . . . . . 78		<b>Renolux (FBS)</b>		
<b>Infant Restraint</b> . . . . . 79		<b>ALL MODELS</b> . . . . . 96		
<b>Infant Rider</b> . . . . . 80				
<b>Playskool Infant</b> . . . . . 81				

List #	Manufacturer	Model # ("X" = more numbers or letters follow)	Customer assistance	
	Model Name		Mfg Date	Problem Type and Consumer Action
1)	Alcot (Childcare)		REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE	
2)	All Our Kids		REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE	
	Alpha Elite		Dorel Juvenile Group: 866-611-3022 / 800-544-1108 / 812-372-0141 www.djgusa.com	
3)	Comfort Infant Seat	22331 BLA, 22332 RLA	07/26/05- 02/28/06	Trim screws on handle can loosen resulting in a potential choking hazard. Contact mfg. at 877-229-1374 for free repair kit. Make sure the handle trim screws are tight and continue to use the existing seat while waiting to receive and install the repair kit.
4)	Comfort Infant Seat	22331 BLA, 22332 RLA	07/26/05- 02/28/06	Some consumers have experienced difficulty installing the base in certain vehicles. Dorel will replace the original version of the base at no charge to the customer. Contact mfg. at 877-229-1374 to determine eligibility for a replacement base.
5)	American Motors		REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE	
6)	Babyhood Industries		REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE	
7)	Bolform Corp.		REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE	
8)	Basic Comfort		800-456-8687	
	Galaxy 2000	960, 961	ALL	Crash test failure. Call mfg. for repair info.
9)	Galaxy 2000	960, 961	11/98- 1/99	Faulty molding of foam backs and cushions may allow separation of part of the booster seat. Call mfg. for repair info.
	Beatrix Potter		Dorel Juvenile Group: 866-611-3022 / 800-544-1108 / 812-372-0141 www.djgusa.com	
10)	Designer 22	02-621-SAL, 02-620-AZY, 02-620-BEA	01/03/02- 02/13/02	Plastic handle can unexpectedly release from the carrying position when used as a carrier. Does not affect safety as a child restraint. Contact mfg. for repair kit.
	Bolform Corp.		No longer in business	
11)	Buckle-Up Harness	84E-019	ALL	Crash test failure. Destroy & replace.
	Britax		888-427-4829 / 704-409-1700 www.britaxusa.com	
12)	Advantage	E902228	03/05/01- 07/26/01	One of the tether brackets of affected seats may separate from the tether attachment point. Contact mfg. for repair kit.
13)	Boulevard	E9L57	03/01/06- 08/01/06	Top tether hook can open during a crash allowing the restraint to change from an upright to a reclined position. Owners are being advised to discontinue use of the top tether when the child reaches 50 lbs. Contact mfg. for replacement labels.
14)	Companion	E9L14	10/31/03- 06/06/04	One or both of two tabs on the bottom of the carrier may not be properly seated and may allow the carrier to rotate in the base too far in a crash. Correct/incorrect assembly can be determined by visual examination. Call mfg. for replacement info. Affected units may be installed without the base until receiving a replacement.

<i>List #</i>	<i>Manufacturer</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance</i>
	<b>Model Name</b>		<b>Mfg Date Problem Type and Consumer Action</b>
<b><i>Britax (continued)</i></b>			
>> 15)	Companion	E9L14, E9L20, E9L80	Pre-11/01/07 User Guide Update - NOT A RECALL: Britax has updated instructions regarding adjustment of the buckle strap position and maximum height for infant carrier use. The inner buckle strap position should be used for infants weighing less than 11 pounds. A child has exceeded the height limit for the Companion when the top of the head is less than one inch from the top of the child restraint or the child's height exceeds 30 inches (76 cm). Contact mfg for updated user guide and labels
16)	Companion	E9L14, E9L20, E9L80	All Consumer Advisory - NOT A RECALL: Britax advises that the user should adjust the carrier handle so that it is completely down and behind the carrier after installation in the vehicle with or without the base assembly. Contact mfg. for additional info.
17)	Decathlon	E9L47	02/12/05-07/31/07 Under certain circumstances the harness adjuster housing may separate from the child restraint shell and allow the adjuster to move out of position. If this happens caregivers may experience difficulty adjusting the harness. Call mfg. for repair info.
18)	Husky	E9L30	08/01/02-12/31/03 Head excursions higher than allowed by FMVSS 213 could result when installed as instructed with a long/serpentine belt path. Contact mfg. for replacement labels advising the use of an alternative short belt path.
19)	Husky	E9L30	Pre-07/24/04 The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.
20)	Marathon	E9L06	Pre-07/24/04 The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.
>> 21)	Marathon	E9L06, E9W06, E906 with top tether lot # KGR 01 A	05/23/06-07/28/06 The top tether hook may open and have the potential to release from the tether anchor if the child exceeds 50 pounds. Contact mfg. for repair kit.
22)	Regent Classic	E9L3998	12/18/06-01/18/07 Affected seats were produced with an incorrect airbag warning label attached to the cover. Contact mfg. to receive a free replacement cover.
23)	Regent	E9L39x	11/10/05-06/18/07 Consumer Advisory/Product Update - NOT A RECALL: Britax has modified the Regent and revised the installation instructions. Contact mfg. to receive a free product update kit that includes a revised user guide, replacement belt-routing label, a longer LATCH connector strap, and adhesive slip resistant strips.
24)	Super Elite	E9031	04/25/01-02/15/02 Harness may allow too much forward head movement. Contact mfg. to receive a free replacement harness system.
25)	Super Elite	E9031	04/01/01-08/31/02 Harness adjuster tab may begin to stick after prolonged use. Harness may loosen if it sticks in the open position. Contact mfg. for repair kit and installation instructions.
26)	Roundabout	161	1/99-3/99 Possible faulty molding of shell can allow excessive head excursion. Call mfg. for repair info.
27)	Traveller Plus (Mfg. by Britax for Snug Seat)	E9L32	Pre-07/24/04 The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.
28)	Wizard	E9L07	Pre-07/24/04 The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.
<b><i>Century Products</i></b>			<b><i>800-837-4044 / 216-468-2000</i></b> <b><i>www.gracobaby.com</i></b>
29)	Accel	45100, 45200, 45600, 45700	04/09/01-05/10/01 Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info.
30)	Bravo	44622, 44630, 44631, 44662	04/09/01-05/10/01 Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info.
31)	Brevera Contour	4875	2/95-7/98 Product improvement campaign: Buckle for the harness can crack or break. Call mfg. for replacement information.
32)	Brevera Premiere	4885	2/95-7/98 Product improvement campaign: Buckle for the harness can crack or break. Call mfg. for replacement information.

<i>List #</i>	<i>Manufacturer</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance</i>	
	<i>Model Name</i>		<i>Mfg Date</i>	<i>Problem Type and Consumer Action</i>
<b>Century (continued)</b>				
33)	Encore	44612, 4662	04/09/01-05/10/01	Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info.
34)	Infant Car Seat	12-565, 4513, 4515, 4516, 4518, 4551, 4557, 4558, 4559, 4564, 4565, 4566, 4568, 4569, 4575, 4576, 4589, 4591, 4593, 4594, 4595, 4597	01/01/91-07/31/97	Handle can break when the seat is used as an infant carrier causing the infant to fall to the ground be injured. Does not affect safety as car seat. Call 800-865-1419 for replacement handle.
35)	Smart Move	44709	04/09/01-05/10/01	Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info.
36)	<b>Chrysler</b>		<b>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</b>	
37)	<b>Collier-Keyworth</b>		<b>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</b>	
	<b>Combi USA</b>		<b>800-992-6624 / 803-548-6633 www.combi-intl.com</b>	
38)	Avatar	8100	11/12/03-05/07/04	Lower latch anchorage does not meet dynamic test requirements of FMVSS 213. Contact mfg. for free in-home repair kit and instructions. Affected models should be installed with the vehicle seat belt. Do not use the seat with the latch until repairs are made.
	<b>Compass Baby</b>		<b>888-899-2229 www.compassbaby.com</b>	
39)	Infant Car Seat	I420 ARD I420 FUO I420 MAR	05/07/06, 05/13/06, and 05/15/06	The metal slide crotch anchor can become dislodged allowing excessive movement of the child and cracking of the plastic shell. This problem was discovered during testing by the manufacturer. There have been no reports of injuries and no calls from consumers regarding problems. Contact mfg. for free repair kit.
	<b>Cosco</b>		<b>Dorel Juvenile Group: 866-611-3022 / 800-544-1108 / 812-372-0141 www.djgusa.com</b>	
40)	Alpha Omega	02-331, 02-332, 02-531, 02-533, 02-537, 02-555.	11/17/00-01/10/01	Tether webbing could be cut and separate in a crash allowing excessive movement of the child. Contact mfg. for free repair kit.
41)	Alpha Omega Alpha Omega Elite	22150, 22180, 22269 22155	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
42)	Arriva	02-729 TED	03/31/99-04/07/99	Airbag warning label is missing on seat pad. Fabric color noted by "TED" is only one affected. Call mfg. for replacement pad.
43)	Arriva	02-665, 02-727, 02-728, 02-729, 02-731, 02-732, 02-733, 02-750, 02-751, 02-755, 02-756, 02-757, 02-774	03/01/95-01/31/00	Handle locks can unexpectedly release when used as a carrier, causing the seat to flip forward. Does not affect safety as car seat. Call mfg. for repair info. [Note: a recall campaign initiated 06/25/03 added models made through 01/31/00 to a previous recall of those made through 09/97.]
44)	Designer 22	22-300-JOS GB1B	08/19/03-10/20/04	Harness can loosen if not properly tightened. Contact mfg. for free repair kit. Parents should continue to use the seat while waiting to receive/install the repair kit but are advised to make sure that the seat is properly adjusted while in use. NOTE: Models involved were sold only as travel systems (with a stroller) and any line code other than GB1B in the model # is not included in the recall.



<i>List #</i>	<i>Manufacturer</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance</i>	
	<i>Model Name</i>		<i>Mfg Date</i>	<i>Problem Type and Consumer Action</i>
<b><i>Cosco (continued)</i></b>				
45)	DreamRide	22-001FSM	12/01/03-04/28/04	Failed to meet back support angle requirements of FMVSS 213. Discontinue rear-facing use and use only as a car bed or request free replacement rear-facing child restraint from DJG. Contact mfg. for warning label and information.
46)	High Rise Booster	22-297, 22-298, 22-299	10/01/03-10/31/03	Incorrect warning label stating it is for use forward facing for children under one year of age rather than OVER one year of age. Contact mfg. for free replacement label and instructions.
47)	Turnabout	02-667, 02-753, 02-756, 02-758, 02-759, 02-760, 02-761, 02-762, 02-763, 02-764, 02-765, 02-770, 02-771, 02-772	03/01/95-01/31/00	Handle locks can unexpectedly release when used as a carrier, causing the seat to flip forward. Does not affect safety as car seat. Call mfg. for repair info. [Note: a recall campaign initiated 06/25/03 added models made through 01/31/00 to a previous recall of those made through 09/97.]
48)	Voyager Infant Seat/Stroller		9/97-10/97	Potential dislodgement from stroller. Does not affect safety as car seat. Call mfg. for repair info.
<b><i>Downunder</i></b>			<b><i>No longer in business</i></b>	
49)	Kangaroo Booster Seat		Pre- 1/98 (AI)	Safety improvement campaign: The shoulder belts may not be properly located when the child is placed in the restraint. The shoulder belt guides may not help achieve correct seat belt placement. Do not use this booster if the shoulder belt does not touch the child's chest.
<b><i>Eddie Bauer</i></b>			<b><i>Dorel Juvenile Group: 866-611-3022 / 800-544-1108 / 812-372-0141 www.djgusa.com</i></b>	
50)	3-in-1	02-331, 02-332, 02-531, 02-533, 02-537, 02-555	11/17/00-01/10/01	Tether webbing could be cut and separate in a crash allowing excessive movement of the child. Contact mfg. for free repair kit.
51)	3-in-1	All Models	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
52)	Alpha Omega Alpha Omega Elite	22750 22755, 22756, 22757, 22770	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
53)	Comfort Infant Seat	22631 LNG, 22630 AFD, 22630 BAL, 22630 FTM, 22630 HPN, 22630 LRS, 22630 LKM.	07/26/05-02/28/06	Trim screws on handle can loosen resulting in a potential choking hazard. Contact mfg. at 877-229-1374 for free repair kit. Make sure the handle trim screws are tight and continue to use the existing seat while waiting to receive and install the repair kit. (The 22630 models are part of the 01726 Eddie Bauer Integrated Travel System.)
54)	Comfort Infant Seat	22631 LNG, 22630 AFD, 22630 BAL, 22630 FTM, 22630 HPN, 22630 LRS, 22630 LKM.	07/26/05-02/28/06	Some consumers have experienced difficulty installing the base in certain vehicles. Dorel will replace the original version of the base at no charge to the customer. Contact mfg. at 877-229-1374 to determine eligibility for a replacement base.
55)	Deluxe 3-in-1	All Models	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
56)	Deluxe Convertible	All Models	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
57)	Designer 22	22-625 AFD GB1B 22-625 GLC GB1B 22-625 EDG GB1B 22-625 MAC GB1B	08/19/03-10/20/04	Harness can loosen if not properly tightened. Contact mfg. for free repair kit. Parents should continue to use the seat while waiting to receive/install the repair kit but are advised to make sure that the seat is properly adjusted while in use. NOTE: Models involved were sold only as travel systems (with a stroller) and any line code other than GB1B in the model # is not included in the recall.
58)	Enspira	22740	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.

<i>List #</i>	<i>Manufacturer</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance</i>
	<i>Model Name</i>		<i>Mfg Date Problem Type and Consumer Action</i>
<b>Evenflo</b>			<b>800-525-2472 / 800-233-5921 / 800-490-7497</b> <b>www.evenflo.com</b>
59)	Cozy Carry	272x, 273x, 468x, 469x, 476x, 477x, 478x, 480x, 481x	10/01/01-07/37/02 Upgrade Kit - Not a Recall: For owners of Cozy Carry infant car seats to improve the performance of the detachable base in certain types of collisions. The kit is only for detachable bases with the words "Cozy Carry" on them. Visit <a href="http://www.cozycarry.com">www.cozycarry.com</a> or call 800-582-6698 for free kit.
60)	Embrace	Begins with 317, 320, 397, 398, 540, 548, 549, 550, 556, 597, 598, 599	Pre-04/08/06 When used as an infant carrier, the handle can unexpectedly release, causing the seat to rotate forward. Handle should not be used until the repair kit has been installed. Affected restraints can continue to be used as a car seat properly installed in a vehicle. Contact mfg. for a free repair kit.
61)	Joyride	Begins with 203, 205, 210, 435, 493	01/88-12/98 When used as an infant carrier, the carry handle can unexpectedly release, cause the seat to flip forward, and cause infant to fall to the ground. Call mfg. for repair info.
62)	On My Way	Begins with 200, 211, 447, 499	Pre-02/10/00 Safety Notification: Alignment posts in base can become bent after repeated use. Contact mfg. for free upgrade kit.
63)	On My Way base	639001, 639002	Pre-02/10/00 Safety Notification: Alignment posts in base can become bent after repeated use. Contact mfg. for free upgrade kit.
64)	Travel Tandem (Joyride + base)	205x, 210x	01/88-12/98 When used as an infant carrier, the carry handle can unexpectedly release, cause the seat to flip forward, and cause infant to fall to the ground. Call mfg. for repair info.
65)	Tribute	378x, 379x	09/08/05-09/22/05 Certain areas of the plastic shell may be prone to stress fractures. Call mfg. to receive a replacement seat.
>> 66)	Triumph	264x, 359x, 389x	09/06/01-10/31/05 Portions of the cloth cover can be pulled back exposing the foam liner in an area that is reachable by a child occupant. A child inside the seat may break off and potentially choke on a piece of the foam liner. Contact mfg. for repair kit.
67)	Triumph	264x	10/20/01-01/31/02 Slide loop connectors in the harness may not be strong enough to fully secure the child in a crash. Call mfg. for repair kit.
68)	Two-in-One	636x, 637x	1/98-3/98 In crash tests, the seat's backrest and base have separated when 5-point harness was being used. Call mfg. for information and replacement seat.
<b>Fisher Price</b>			<b>800-432-5437</b> <b>www.fisher-price.com</b>
69)	Safe Embrace	79700	5/97-3/98 Harness adjuster. Call mfg. for repair info.
70)	<b>Ford</b>		<b>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</b>
71)	<b>General Motors</b>		<b>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</b>
72)	<b>Gerry</b>		<b>REFER TO OLDER MODELS LIST - ALL MODELS WITH RECALLS ARE OLDER THAN 10 YEARS</b>
<b>Graco</b>			<b>800-345-4109</b> <b>www.gracobaby.com</b>
73)	SnugRide #'s	7493, 7497, 7499, 841101, 841102, 841103, 841203, 8412T02, 8457, 8458, 8459, 8460, 8462, 8471, 8472, 8473, 8474, 8476, 8477, 8478 See Note	08/31/99-02/28/02 May be missing 1 or 2 metal hooks and their retainer pins on the base of the carrier shell or the "U" shaped bars on the carrier shell that are used to attach the carrier to the base. If the hooks, pins or "U" bars are missing, the carrier may not be securely attached to the base and the carrier could detach from the base in the event of a sudden stop or crash. Call Graco to receive a free replacement seat or base. NOTE: All affected model numbers may also begin with the letter "A" and/or also be followed by letters.

<i>List #</i>	<i>Manufacturer Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance</i>
	<i>Model Name</i>	<i>Mfg Date Problem Type and Consumer Action</i>
<b>Graco (continued)</b>		
74)	SnugRide #'s 8402, 8402L, 8403x, 8412, 8442x, 8443, 8443L, 8444, 8444L, 8446, 8446L, 8447, 8447L, 8448, 8448L, 8457, 8458, 8459, 8463x, 8464, 8470, 8471, 8478, 8601, 8602x, 8603M, 8605x, 8607x, 8608D, C844342	03/01/02-03/08/03 May have missing hardware used to attach the carrier to the base. Contact mfg. at 866-473-0163 or <a href="http://www.gracobaby.com">www.gracobaby.com</a> for inspection and repair information. All models can safely be installed without the base. [NOTE: The initial 03/12/03 recall campaign for this problem included models manufactured through 03/06/03. A recall extension announced 08/13/03 added models manufactured through 03/08/03.]
>> 75)	SnugRide 8609x, 8616x, 8643x, 8645x, 8646x	08/01/06-06/30/07 The backing of the seat pad may pull away from the seams in an area reachable to the child occupant, exposing the pad filling and posing a potential choking hazard. Contact mfg. For repair kit.
76)	ComfortSport 8629x, 8630x, 8631x, 8632x, 8635x, 8639x, 8C00x, 8C01x, 8C02x, 8C03x, 8C04x, 8433x	01/02/07-07/31/07 Lower Anchorage belt may have been misrouted during assembly process. Use the vehicle seatbelt instead of LATCH to install affected models in the rear-facing position until it is inspected and, if necessary, corrected. Call mfg. or visit <a href="http://gracobaby.com">gracobaby.com</a> website for additional info.
77)	<b>International</b>	<b>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</b>
<b>Kolcraft</b>		
<b>800-453-7673 / 312-247-4494</b>		
78)	Infant Car Seat 1383x	1/93-6/99 Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
79)	Infant Restraint 43xxx	1/93-6/99 Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
80)	Infant Rider 1312x, 1382x, 1383x, 368xx	1/93-6/99 Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
81)	Playskool Infant Car Seat 77005, 77007	1/93-6/99 Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
82)	Plus 4 1382x, 1383x, 1384x, 368xx	1/93-6/99 Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
83)	Plus 5 1382x, 1383x, 1384x, 1385x, 368xx	1/93-6/99 Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
84)	Secura 43xxx	1/93-6/99 Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
85)	Travel-About 1382x, 1383x, 1384x, 1385x	1/93-6/99 Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
86)	<b>Lin Lih/MCP Ent.</b>	<b>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</b>
<b>Mercedes-Benz USA</b>		
<b>800-367-6372</b>		
<b><a href="http://www.mbusa.com">www.mbusa.com</a></b>		
87)	Booster BQ6910157, BQ6910163	02/01/97-07/31/99 BabySmart airbag deactivation device may not automatically deactivate the passenger airbag. Contact mfg. for free replacement seat and instructional video.
88)	Infant Restraint BQ6910155	02/01/97-07/31/99 BabySmart airbag deactivation device may not automatically deactivate the passenger airbag. Contact mfg. for free replacement seat and instructional video.
89)	Kiddy TopSafe (mfg. by Sicartex) B66868203 B66868204 B66868209	03/01/03-11/30/03 Lower LATCH attachment may not be strong enough to hold in the event of a crash. Immediately replace with another model and return Kiddy Top seat to Mercedes-Benz dealer for refund. Install with vehicle seat belt until replacement is obtained. Contact Mercedes-Benz for further information.

List #	Manufacturer	Model # ("X" = more numbers or letters follow)	Customer assistance	
	Model Name		Mfg Date	Problem Type and Consumer Action
<b>Mia Moda</b>			<b>866-642-6632</b> <b>www.miamodainc.com</b>	
>> 90)	Viva	5000, 5001	12/19/06-02/06/07	The lower anchor connector adjuster assembly may interfere with the connection of the infant carrier to the restraint base when installed using LATCH. Installation with seat belt is not affected. In addition, registration cards were not provided with the Viva or separately sold bases. Contact mfg. For repair kit and to register CR with mfg.
<b>Peg Perego USA</b>			<b>877-737-3468 / 219-482-8191</b> <b>www.perego.com</b>	
91)	Primo Viaggio	CS00MU1, CS00US1, CS00US8	02/01/01-06/10/01	The latch mechanism securing the seat to the base does not completely engage on a small number of seats due to improper positioning of the metal reinforcement bracket. Call mfg. for repair info. Note: Primo Viaggio infant seat sold separately and with strollers as part of Pliko and Primo Viaggio Travel Systems.
92)	Primo Viaggio	CS00MU1, CS00US1, CS00US8, LV34USL, LV34USN, LN34S09, LN34S10, ST33USL, ST33USN, ST38USL, ST38USN, AL33USL, AL33USN, AL34USN, AL34USL	05/20/01-02/15/02	The harness adjustment/locking mechanism may not fully lock and allow the harness to slip. The strap tension adjuster cover of affected models have a red circle around a dark button. Contact mfg, for full identification and repair information. Note: Primo Viaggio infant seat sold separately and with strollers as a part of Pliko, Primo Viaggio, and Atlantico Travel Systems.
<b>Playskool</b>			<b>Contact Kolcraft: 800-453-7673</b>	
93)	Infant Car Seat	77005, 77007	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
94)	<b>Pride Trimble/Virco</b>		<b>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</b>	
95)	<b>Questor</b>		<b>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</b>	
96)	<b>Renolux (FBS)</b>		<b>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</b>	
<b>Safeline Kids</b>			<b>800-829-1625</b> <b>www.tripleplayproducts.com</b>	
97)	Sit'n'Stroll	2003	09/01/02-10/21/03	Child's head may move too far forward in a crash when lower forward-facing belt path or shoulder and buckle pads are used. Remove and discard shoulder and buckle pads and use upper forward-facing belt path only. Contact mfg. for revised instructions and labels.
98)	Sit'n'Stroll	2240	04/01/01-10/01/01	The FAA certification statement on label is in yellow lettering instead of the required RED lettering. Flight attendants may not allow its use on an airplane. Contact mfg. for replacement label.
99)	Sit'n'Stroll	3240	11/1/96-6/30/99	Labels recommend use rear-facing for children up to 25 pounds. Contact Mfg. for new labels to be placed over the existing labels. New labels recommend use rear-facing for children up to 22 pounds.
<b>Safety 1st</b>			<b>Dorel Juvenile Group: 866-611-3022 / 800-544-1108 / 812-372-0141</b> <b>www.djgusa.com</b>	
100)	Alpha Elite	All Models	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.

<i>List #</i>	<i>Manufacturer</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance</i>
	<b>Model Name</b>		<b>Mfg Date Problem Type and Consumer Action</b>

**Safety 1st (continued)**

101)	Alpha Omega Alpha Omega Elite	22151 22455	11/01/03- 12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
102)	Alpha Sport	All Models	11/01/03- 12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
103)	Designer 22	02-621-SAL, 02-620-AZY, 02-620-BEA	01/03/02- 02/13/02	Plastic handle can unexpectedly release from the carrying position when used as a carrier. Does not affect safety as a child restraint. Contact mfg. for repair kit.
104)	Designer 22	22-325 CMB GB1B 22-325 VIN GB1B 22-325 DTA GB1B 22-325 TST GB1B	08/19/03- 10/20/04	Harness can loosen if not properly tightened. Contact mfg. for free repair kit. Parents should continue to use the seat while waiting to receive/install the repair kit but are advised to make sure that the seat is properly adjusted while in use. NOTE: Models involved were sold only as travel systems (with a stroller) and any line code other than GB1B in the model # is not included in the recall.
105)	Intera	22460	11/01/03- 12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
106)	Enspira	22450, 22451, 22452, 22453, 22480, 22481	11/01/03- 12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.

**Snug Seat****800-336-7684****[www.snugseat.com](http://www.snugseat.com)**

107)	Gorilla	200-1000	07/26/02- 01/15/03	A washer in tether anchor kit does not meet corrosion requirements of FMVSS 213. Contact mfg. for replacement kit # FW-50250-12-ZY
108)	Spelcast	600-1000	07/26/02- 01/15/03	A washer in tether anchor kit does not meet corrosion requirements of FMVSS 213. Contact mfg. for replacement kit # FW-50250-12-ZY
109)	Traveller Plus (Mfg. by Britax for Snug Seat)	E9L32	Pre- 07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. <u>Contact Britax</u> at 800-683-2045 or 704-409-1700 for repair kit.

110) **Strolee****REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE**111) **TRW****REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE****XSCi****800-630-6850 / 719-593-8881**

112)	Pioneered ACIS	None*	02/01/02- 03/07/02	Exceeds the maximum head excursion criteria of FMVSS 213. In a crash, the cradle can detach from the deflector base. Contact mfg for replacement information (replacements produced by an alternate mfg.) *No model number is associated, but affects serial numbers 01C-000000002 to 01C-000000108. [NHTSA No.: 02E-024] **NOTE: According to XSCi, all seats that were affected by this recall have been returned (as of May 8, 2002) and thus should not be found in use.**
------	-------------------	-------	-----------------------	---

<i>Integrated (built-into the vehicle) seats</i>					
<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model Year</i>	<i>Customer assistance Mfg Date</i>	<i>Problem Type</i>	<i>and Consumer Action</i>
<b>Chrysler</b>			<b>800-853-1403 / 800-992-1997</b>		
113)	Town and Country	1996	Bolts securing seat to frame can break. Contact Chrysler Corp. or dealer for repair		
114)	Town and Country	1988	Harness restraint webbing incorrectly routed around the metal reinforcement bar on these seats. Child may not be properly restrained in the event of a crash. Dealers will inspect and correct improperly routed webbing.		
115)	Town and Country	1996, 1997	Safety improvement campaign: The latch plate can remain in the locked position due to food or other items. Owners are being provided with decals/instructions describing the operation of the buckle and the latch plate		
116)	Town and Country	1996, 1997	The harness on the integrated child seat can become difficult to release when the safety belt latch plate gets dirty. Dealers will clean the latch, modify the emergency release anchor, and provide additional instructions.		
<b>Dodge</b>			<b>800-853-1403 / 800-992-1997</b>		
117)	Caravan Grand Caravan	1996	Bolts securing seat to frame can break. Contact Chrysler Corp. or dealer for repair		
118)	Caravan Grand Caravan	1988	Harness restraint webbing incorrectly routed around the metal reinforcement bar on these seats. Child may not be properly restrained in the event of a crash. Dealers will inspect and correct improperly routed webbing.		
119)	Caravan Grand Caravan	1996, 1997	Safety improvement campaign: The latch plate can remain in the locked position due to food or other items. Owners are being provided with decals/instructions describing the operation of the buckle and the latch plate		
120)	Caravan Grand Caravan	1996, 1997	The harness on the integrated child seat can become difficult to release when the safety belt latch plate gets dirty. Dealers will clean the latch, modify the emergency release anchor, and provide additional instructions.		
<b>Ford</b>			<b>800-392-3673</b>		
121)	Windstar	1998	The headrest lockout mechanism on the integrated child seats may not engage and lock the headrest in the "down" position, as intended. Replace bench seats with integrated child seats with seats built with revised headrest lockout mechanisms.		
<b>Plymouth</b>			<b>800-853-1403 / 800-992-1997</b>		
122)	Voyager Grand Voyager	1996	Bolts securing seat to frame can break. Contact Chrysler Corp. or dealer for repair		
123)	Voyager Grand Voyager	1988	Harness restraint webbing incorrectly routed around the metal reinforcement bar on these seats. Child may not be properly restrained in the event of a crash. Dealers will inspect and correct improperly routed webbing.		
124)	Voyager Grand Voyager	1996, 1997	Safety improvement campaign: The latch plate can remain in the locked position due to food or other items. Owners are being provided with decals/instructions describing the operation of the buckle and the latch plate		
125)	Voyager Grand Voyager	1996, 1997	The harness on the integrated child seat can become difficult to release when the safety belt latch plate gets dirty. Dealers will clean the latch, modify the emergency release anchor, and provide additional instructions.		

Child restraints (CRs) manufactured before 1981 were not required to be crash tested and must not be used. Most child passenger safety advocates recommend that CRs older than ten years should be replaced by a new one. Note that some manufacturers and safety advocates recommend replacing CRs before 10 years. **Following are recalls and safety notifications that were issued for models where all or most models sold are at least 10 years old as of August 23, 2007.** Updated versions of this list and a listing of recalls on models less than 10 years old are posted on-line at [www.hsrb.unc.edu](http://www.hsrb.unc.edu).

## CHILD RESTRAINTS AT LEAST 10 YEARS OLD

### Index of Recalls and Safety Notifications

Model numbers (noted by a "#") and model names for child restraints under recall are followed by their list number (that corresponds to the "List #" for each listing). Model numbers followed by an "x" should be read as "model numbers beginning with." If the model # is not found, check the model name also. Model #'s are not available for all model names.

<b>Alcot (Childcare)</b>	# 4214	212, 213, 214, 215	# 4583	236, 237	# 02-404	264
Child Love Seat	# 4223	212, 213, 214, 215	# 4585	236, 237	# 02-514-BWE	263
	# 4235	212, 213, 214, 215	# 4590	240	# 02-518-NDF	263
<b>All Our Kids</b>	# 4253	216, 217, 218	# 4600	239	# 02-584-OXF	263
# 600	# 4261	217, 218	# 4750	243	# 02-719 ARQ	250
# 602	# 4263	216, 217, 218	100	209, 210	# 02-751	248
Little Cargo Vest	# 4265	216, 217, 218	1000 STE	211	# 02-790	251
	# 4266	217, 218	200	212, 213, 214, 215	# 02-821	264
<b>American Motors</b>	# 4300	219	2000 STE	216, 217, 218	# 02-890	251
Child Love Seat	# 4302	219	300	219	# 181A	252
Infant Love Seat	# 4303	219	3000 STE	220, 221, 222, 223, 224	# 181B	252
	# 4310	219			# 313	254
<b>Babyhood Industries</b>	# 4323	219	3500 STE	225	# 323	255
# 810	# 4334	219	4-In-1	226, 227	# 423	255
# 8200	# 4335	219	400XL	228, 229	# 81A	252
Baby-Sitter	# 4353	221, 222, 224	5000 STE	230, 231, 232, 233, 234	# 81B	252
Wonda Chair	# 4365	221, 222, 223, 224			Arriva	248
	# 4365DT	220	5500 STE	235	Commuter	249
<b>Bolform Corp.</b>	# 4366	220, 221, 222, 223, 224	580	236, 237	Dream Ride	250
# 84E-019	# 4367	223, 224	Affinity	238	Lxry Sft Shld Auto Trac	251
Buckle-Up Harness	# 4368	221, 222, 223, 224	Child Love Seat	239	Safe and Easy	254
	# 4369	223, 224	Infant Car Seat	240	Safe and Snug	255
<b>Britax</b>	# 4380	223, 225	Infant Love seat	241	Safe-T Mate	253
# 101	# 4381	223	Smart Fit	242	Safe-T-Shield	252
Freeway	# 4400	228, 229	Smart Move	243	Sft Shld Auto Trac	259
	# 4434	228, 229	<b>Chrysler</b>		Soft Shield	258
<b>Century</b>	# 4436	228, 229	Child Love Seat	244	Soft Shield Deluxe	260
# 11-564	# 4446	228, 229			Touriva	261, 262, 263, 264
# 11-565	# 4450	230, 231, 233, 234	<b>Collier-Keyworth</b>		<b>Evenflo</b>	
# 11-570	# 4460	230, 231, 232, 233, 234	Co-Pilot	245	# 201	277
# 11-575	# 4470	231, 232, 233, 234	Commuter	247	# 202	275, 277
# 11-576	# 4475	230, 231, 232, 233, 234	Safe and Sound II	246	# 205x	285
# 11-578	# 4476	232, 233			# 206	278
# 11-595	# 4480	232, 235	<b>Cosco</b>		# 207x	279
# 11-597	# 4490	232, 235	# 02-014-EMF	262	# 219164	286
# 11-598	# 4500	241	# 02-014-GDM	262	# 219180	286
# 11-599	# 4510	241	# 02-015-PDL	262	# 219186	286
# 11-600	# 4520	241	# 02-084	261, 264	# 219188	286
# 11-650	# 4525	242	# 02-086	249	# 21940	286
# 4100	# 4535	240	# 02-090	258	# 219x	256, 265, 273
# 4153	# 4560	240	# 02-094	264	# 221	280
# 4163	# 4565	240	# 02-096	264	# 222	281
# 4180	# 4575	238	# 02-190	260	# 223	281
# 4200	# 4580	237	# 02-290	259	# 224x	256, 265, 271, 272, 273
# 4210	# 4581	236, 237				

**Evenflo (continued)**

# 225x ..... 256, 265, 273  
 # 227 ..... 289  
 # 228 ..... 284  
 # 229x ..... 256, 265, 273, 282  
 # 231 ..... 288  
 # 232 ..... 290  
 # 242 ..... 270  
 # 244x ..... 257  
 # 401 ..... 280  
 # 402 ..... 280  
 # 403 ..... 280  
 # 404 ..... 280  
 # 405 ..... 280  
 # 406 ..... 280  
 # 407 ..... 280  
 # 408 ..... 280  
 # 409 ..... 280  
 # 410 ..... 266  
 # 411 ..... 267  
 # 412 ..... 268  
 # 414 ..... 268  
 # 415 ..... 268  
 # 416 ..... 268  
 # 4176 ..... 281  
 # 420 ..... 287  
 # 441 ..... 274, 275, 277  
 # 442 ..... 274, 275, 277  
 # 443 ..... 274, 275, 277  
 # 444 ..... 274, 275, 277  
 # 445 ..... 274, 275, 277  
 # 446 ..... 274, 275, 277  
 # 447 ..... 274, 275  
 # 448 ..... 274, 275, 277  
 # 453 ..... 283, 284  
 # 454 ..... 283, 284  
 # 456 ..... 276, 277  
 # 458 ..... 276, 277  
 # 470 ..... 269, 270  
 # 471 ..... 269, 270  
 # 492x ..... 279  
 410 ..... 266  
 Bobby Mac Champion ..... 267  
 Bobby Mac Deluxe ..... 268  
 Booster Seat ..... 269, 270  
 Champion ..... 271, 272, 273  
 Dyn-O-Mite ..... 274, 275  
 Infant Car Seat ..... 276, 277  
 On My Way ..... 278, 279  
 One-Step ..... 280  
 One-Step Deluxe ..... 281  
 Scout ..... 256, 282  
 Seven Year Seat ..... 283, 284  
 Sidekick ..... 257  
 Travel Tandem ..... 285  
 Trooper ..... 265, 286  
 Ultara 1 ..... 287, 288  
 Ultara II ..... 289, 290

**Fisher Price**

# 9100 . 291, 292, 293, 294, 295,  
 296, 297, 298, 299  
 # 9101 . 292, 293, 295, 296, 297,  
 298, 299  
 # 9104 ..... 300, 303, 304  
 # 9149 ..... 301  
 # 9173 ..... 302  
 Booster ..... 303, 304  
 Car Seat .... 291, 292, 293, 294,  
 295, 296, 297, 298, 299  
 Delux Car Seat ..... 300  
 Infant Seat ..... 301, 302

**Ford**

Infant Love Seat ..... 305

**General Motors**

Child Love Seat ..... 307  
 Infant Love Seat ..... 306

**Gerry**

# 626 ..... 309  
 Guardian ..... 308  
 Secure Ride ..... 309

**Graco**

GT 1000 ..... 310

**International**

Astroseat ..... 311

**Kolcraft**

# 131-101 ..... 331  
 # 13123 ..... 330  
 # 13833 ..... 313, 329, 334  
 # 13842 ..... 313, 329, 334  
 # 13852 ..... 313, 329, 334  
 # 138xx ..... 317, 327, 328, 333  
 # 140-155 ..... 325  
 # 150-100 ..... 336  
 # 180-100 ..... 320  
 # 180-150 ..... 320, 321  
 # 180-200 .... 314, 315, 321, 322  
 # 180-300 ..... 314, 315  
 # 180-400 ..... 325  
 # 180-600 ..... 312, 316  
 # 180-601 ..... 312  
 # 19127 ..... 318, 319  
 # 19128 ..... 318  
 # 19129 ..... 318  
 # 19130 ..... 318  
 # 368xx ..... 317, 327, 328, 333  
 # 77001 ..... 326  
 # 77002 ..... 326  
 Automate ..... 312  
 Carter Travel 5 ..... 313  
 Dial-A-Fit ..... 314, 315

Dial-A-Fit II ..... 316  
 Flip 'N' Go ..... 318  
 Flip 'N' Go II ..... 319  
 Infant Rider ..... 317  
 Perfect Fitt ..... 320, 321, 322  
 Performa ..... 323, 324  
 Playskool ..... 325, 326  
 Plus 4 ..... 327  
 Plus 5 ..... 328, 329  
 Rock 'N' Ride ..... 330, 331  
 Secure Fit ..... 332  
 Travel About ..... 333, 334  
 Traveler 700 ..... 335, 336, 337

**Lin Lih/MCP**

# 180-200 ..... 339  
 # 180-300 ..... 339  
 Lin Lih ..... 338, 339

**Playskool**

# 140-155 ..... 340  
 # 180-400 ..... 340  
 # 77001 ..... 341  
 # 77002 ..... 341  
 Car Seat ..... 340, 341

**Pride Trimble/Virco**

# 832 ..... 344  
 # 890 ..... 342, 343  
 # 891 ..... 342, 343  
 # 892 ..... 342, 343  
 Click-n-Go ..... 342, 343  
 Pride Ride ..... 344

**Questor**

Kantwet Car Seat ..... 345

**Renolux (FBS)**

GT 1000 ..... 346  
 GT 2000 ..... 347, 348, 349  
 GT 4000 ..... 350, 351  
 GT 5000 ..... 352, 353  
 GT 5000 Turn A Tot ... 354, 355,  
 356  
 GT 5500 ..... 357, 358  
 GT 7000 ..... 359, 360, 361

**Safeline Kids**

# 3240 ..... 362  
 Sit'n'Stroll ..... 362

**Strolee**

# 599 ..... 364  
 # 605 ..... 366  
 # 609 ..... 365  
 # 610 ..... 365  
 GT 3000 ..... 367  
 Quick Click ..... 366  
 Wee Care ..... 363, 364, 365

**TRW**

Child Love Seat ..... 369  
 Infant Love Seat ..... 368

**Volvo**

All ..... 370



<i>List #</i>	<i>Manufacturer</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance</i>	
	<i>Model Name</i>		<i>Mfg Date</i>	<i>Problem Type and Consumer Action</i>
<b><i>Alcot (Childcare)</i></b>			<b><i>ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</i></b>	
200)	Child Love Seat		3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.
<b><i>All Our Kids</i></b>			<b><i>ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</i></b>	
201)	Little Cargo Vest	600	4/93-3/94	Flammability of upholstery. Call mfg. for repair info.
202)	Little Cargo Vest	602	3/94-9/94	Flammability of upholstery. Call mfg. for repair info.
<b><i>American Motors</i></b>			<b><i>ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</i></b>	
203)	Infant Love Seat		1/81-12/82	Plastic shell may develop cracks. Destroy & replace seat.
204)	Child Love Seat		3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.
<b><i>Babyhood Industries</i></b>			<b><i>ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</i></b>	
205)	Wonda Chair	810	Pre 12/82	Harness may be misrouted. Call mfg. for instructions.
206)	Baby-Sitter	8200	1/92-6/93	Buckle. Call mfg. for repair info.
<b><i>Bolform Corp.</i></b>			<b><i>ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY &amp; REPLACE</i></b>	
207)	Buckle-Up Harness	84E-019	ALL	Crash test failure. Destroy & replace.
<b><i>Britax</i></b>			<b><i>888-427-4829 / 704-409-1700 www.britaxusa.com</i></b>	
208)	Freeway	101	6/96-4/97	Buckle. Call mfg. for repair info.
<b><i>Century Products</i></b>			<b><i>800-837-4044 / 216-468-2000</i></b>	
209)	100	4100	1/81-4/81	Upholstery buttons. Call mfg. for repair info.
210)	100	4100	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
211)	1000 STE	4153, 4163, 4180	12/90-10/91	Incorrect labels on seat. Call mfg. for corrections
212)	200	4200, 4210, 4235, 4214, 4223	1/81-4/81	Upholstery buttons. Call mfg. for repair info.
213)	200	4200, 4210, 4235, 4214, 4223	June 81	Washers on frame. Call mfg. for repair info.
214)	200	4200, 4210, 4235, 4214, 4223	1/81-1/83	Buckle. Call mfg. for repair info.
215)	200	4200, 4210, 4235, 4214, 4223	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
216)	2000 STE	4253, 4263, 4265	4/84-6/89	Harness. Call mfg. for repair info.
217)	2000 STE	4253, 4261, 4263, 4265, 4266	12/90-10/91	Incorrect labels on seat. Call mfg. for corrections
218)	2000 STE	4253, 4261, 4263, 4265, 4266	12/91-4/92	Buckle. Call mfg. for repair info.
219)	300	4300, 4302, 4303, 4323, 4310, 4334, 4335	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
220)	3000 STE	4365DT, 4366	3/89-10/89	Upholstery. Call mfg. for repair info.

<i>List #</i>	<i>Manufacturer</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance</i>	
	Model Name		Mfg Date	Problem Type and Consumer Action

***Century Products (continued)***

221)	3000 STE	4353, 4365, 4366, 4368	5/90-6/90	Crash test failure of buckle. Call mfg. for repair info.
222)	3000 STE	4353, 4365, 4366, 4368	Pre 91	Buckle instructions. Call mfg. for corrections
223)	3000 STE	4365, 4366, 4367, 4368, 4369, 4380, 4381	12/90-10/91	Incorrect labels on seat. Call mfg. for corrections
224)	3000 STE	4353, 4365, 4366, 4367, 4368, 4369	10/89-4/92	Buckle. Call mfg. for repair info.
225)	3500 STE	4380	12/90-4/92	Buckle. Call mfg. for repair info.
226)	4-In-1 Travel System	11-570, 11-597, 11-600, 11-650	9/95-5/96	Buckle. Call mfg. for repair info.
227)	4-In-1 Travel System	11-564, 11-565, 11-570, 11-575, 11-576, 11-578, 11-595, 11-597, 11-598, 11-599, 11-600	01/01/91-07/31/97	Handle can break when the seat is used as an infant carrier causing the infant to fall to the ground be injured. Does not affect safety as car seat. Call 800-865-1419 for replacement handle.
228)	400XL	4400, 4434, 4436, 4446	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
229)	400XL	4400, 4434, 4436, 4446	11/84-4/86	Shield. Call mfg. for repair info.
230)	5000 STE	4450, 4460, 4475	12/88-11/89	Buckle. Call mfg. for repair info.
231)	5000 STE	4450, 4460, 4470, 4475	5/90-6/90	Crash test failure of buckle. Call mfg. for repair info.
232)	5000 STE	4460, 4470, 4475, 4476, 4480, 4490	12/90-10/91	Incorrect labels on seat. Call mfg. for corrections
233)	5000 STE	4450, 4460, 4470, 4475, 4476	09/89-4/92	Buckle. Call mfg. for repair info.
234)	5000 STE	4450, 4460, 4470, 4475,	Pre 91	Buckle instructions. Call mfg. for corrections.
235)	5500 STE	4480, 4490	01/91-4/92	Buckle. Call mfg. for repair info.
236)	580	4581, 4583, 4585	6/86-10/89	Screws for carry handle. Call mfg. for repair info.
237)	580	4580, 4581, 4583, 4585	7/86-12/89	Incorrect instructions. Call mfg. for corrections.
238)	Affinity Infant Seat	4575	9/95-5/96	Buckle. Call mfg. for repair info.
239)	Child Love Seat	4600	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.
240)	Infant Car Seat	4535, 4560, 4565, 4590	9/95-5/96	Buckle. Call mfg. for repair info.
241)	Infant Love seat	4500, 4510, 4520	1/81-12/82	Plastic shell may develop cracks. Destroy & replace seat.
242)	Smart Fit	4525	9/95-5/96	Buckle. Call mfg. for repair info.
243)	Smart Move	4750	11/95-2/96	Buckle. Call mfg. for repair info.

***Chrysler******ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE***

244)	Child Love Seat	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.
------	-----------------	------------	---

***Collier-Keyworth******800-544-1108***

245)	Co-Pilot	82-83	Shield. Call mfg. for repair info.
246)	Safe and Sound II	12/84-4/85	Buckle. Call mfg. for repair info.
247)	Commuter	10/87-02/88	Padding. Call mfg. for repair info.

<i>List #</i>	<i>Manufacturer</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance</i>
	<b>Model Name</b>		<b>Mfg Date      Problem Type and Consumer Action</b>

***Cosco******Dorel Juvenile Group: 800-544-1108 / 812-372-0141***

248)	Arriva	02-751	03/95-05/95	Buckle. Call mfg. for repair info.
249)	Commuter	02-086	11/87-2/88	Upholstery/padding. Call mfg. for repair info.
250)	Dream Ride	02-719 ARQ	01/89-01/94	Upholstery flammability. Call mfg. for repair info.
251)	Luxury Soft Shield Auto Trac	02-790, 02-890	10/89-6/90	Crash test failure. Call mfg. for repair info.
252)	Safe-T-Shield	81A or B, 181A or B	10/80-6/83	Shield. Call mfg. to replace seat.
253)	Safe-T Mate		1984	Wrong instructions. Call mfg. for repair info.
254)	Safe and Easy	313	1/84-6/85	Plastic shell. Call mfg. for repair info.
255)	Safe and Snug	323, 423	1/84-6/85	Plastic shell. Call mfg. for repair info.
256)	Scout	219x, 224x, 225x, 229x	10/96-02/97	Crash test failure. Call mfg. for repair info.
257)	Sidekick Booster	244x	04/96-5/97	Crash test failure of shield. Use only as belt-positioning booster. Call mfg. for refund info.
258)	Soft Shield	02-090	10/89-6/90	Crash test failure. Call mfg. for repair info.
259)	Soft Shield Auto Trac	02-290	10/89-6/90	Crash test failure. Call mfg. for repair info.
260)	Soft Shield Deluxe	02-190	10/89-6/90	Crash test failure. Call mfg. for repair info.
261)	Touriva	02-084	5/94-8/94	Buckle. Call mfg. for repair info.
262)	Touriva Shield	02-014-EMF, 02-014-GDM, 02-015-PDL	8/97 (Mold #3)	Crash test failure of shell in front-facing recline position. Call mfg. for repair info.
263)	Touriva 5-point	02-514-BWE, 02-584-OXF, 02-518-NDF	8/97 (Mold #3)	Crash test failure of shell in front-facing recline position. Call mfg. for repair info.
264)	Touriva T-Shield	02-084, 02-094, 02-096, 02-404, 02-821	5/96-11/97	Crash test failure of post-test release pressure standard for the buckle. Call mfg. for repair info.
265)	Trooper	219x, 224x, 225x, 229x	10/96-2/97	Crash test failure. Call mfg. for repair info.

***Evenflo******800-525-2472 / 800-233-5921***

266)	410	410	6/88-4/89	Harness/shield. Call mfg. for repair info.
267)	Bobby Mac Champion	411	4/85-4/90	Buckle. Call mfg. for repair info.
268)	Bobby Mac Deluxe	412, 414, 415, 416	4/85-4/90	Buckle. Call mfg. for repair info.
269)	Booster Seat	470, 471	2/87-8/88	Upholstery buttons. Call mfg. for repair info.
270)	Booster Seat	242, 470, 471	4/85-4/90	Buckle. Call mfg. for repair info.
271)	Champion	224x	06/93-11/96	Crash test failure. Call mfg. for repair info.
272)	Champion	224x	06/93-11/96	Crash test failure. Call mfg. for repair info.
273)	Champion	219x, 224x, 225x, 229x	10/96-2/97	Crash test failure. Call mfg. for repair info.
274)	Dyn-O-Mite	441 thru 448	1/85-1/89	Crash test failure. Call mfg. for repair info.
275)	Dyn-O-Mite	202, 441 thru 448	4/85-4/90	Buckle. Call mfg. for repair info.

<i>List #</i>	<i>Manufacturer</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance</i>
	<b>Model Name</b>		<b>Mfg Date      Problem Type and Consumer Action</b>

***Evenflo (continued)***

276)	Infant Car Seat	456, 458	Pre 4/89	Crash test failure. Call mfg. for repair info.
277)	Infant Car Seat	201, 202, 441 thru 446, 448, 456, 458	4/85-4/90	Buckle. Call mfg. for repair info.
278)	On My Way	Begins with 206	05/94-05/95	Crash test failure. Call mfg. for repair info.
279)	On My Way	Begins with 207, 492	12/95-07/97	When used as a carrier, the locking mechanism on the handle can slip, flipping the seat forward and tossing the baby on the ground. Call mfg. for repair info.
280)	One-Step	221, 401 thru 409	04/85-04/90	Buckle. Call mfg. for repair info.
281)	One-Step Deluxe	222, 223, 4176	04/85-04/90	Buckle. Call mfg. for repair info.
282)	Scout	229x	06/93-12/96	Crash test failure. Call mfg. for repair info.
283)	Seven Year Seat	453, 454	02/87-08/88	Upholstery buttons. Call mfg. for repair info.
284)	Seven Year Seat	228, 453, 454	04/85-04/90	Buckle. Call mfg. for repair info.
285)	Travel Tandem (Joyride + base)	205x	01/88-03/96	Test failure with base. Use without base and call mfg. for repair info.
286)	Trooper (shield)	21940, 219164, 219180, 219186, 219188	11/95-1/96	Instructions. Call mfg. for new instructions
287)	Ultara 1	420	9/88-7/89	Buckle. Call mfg. for repair info.
288)	Ultara 1	231	2/93-8/93	Plastic sleeve on harness. Call mfg. for repair info.
289)	Ultara II	227	1/90-6/90	Crash test failure. Call mfg. for repair info.
290)	Ultara II	232	2/93-8/93	Plastic sleeve on harness. Call mfg. for repair info.

***Fisher Price******800-355-8882 / 800-433-5437 / 716-687-3934***

291)	Car Seat	9100	Pre-1987	Harness/shield. Call mfg. for repair info.
292)	Car Seat	9100, 9101	4/85-1/89	Upholstery. Call mfg. for repair info.
293)	Car Seat	9100, 9101	2/90-3/90	Buckle. Call mfg. for repair info.
294)	Car Seat	9100	4/85-8/85	Shield. Call mfg. for repair info.
295)	Car Seat	9100, 9101	5/87-1/89	Buckle. Call mfg. for repair info.
296)	Car Seat	9100, 9101	2/89-11/89	Buckle (extended 5/87-1/89). Call mfg. for repair info.
297)	Car Seat	9100, 9101	Pre 91	Loose button. Call mfg. for repair info.
298)	Car Seat	9100, 9101	2/91-1/92	Harness/shield. Call mfg. for repair info.
299)	Car Seat	9100, 9101	Pre 7/89	Label on shield. Call mfg. for repair info.
300)	Delux Car Seat	9104	6/15-9/92	Buckle. Call mfg. for repair info.
301)	Infant Seat	9149	1/91-2/91	Shield. Call mfg. for repair info.
302)	Infant Seat	9173	9/94-10-94	Air bag label. Call mfg. for repair info.
303)	Booster	9104	4/92-9/92	Buckle. Call mfg. for repair info.
304)	Booster	9104	4/92-9/92	Buckle. Call mfg. for repair info.

***Ford******ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE***

305)	Infant Love Seat	81/82	Plastic shell may develop cracks. Destroy & replace seat.
------	------------------	-------	---

***General Motors******ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE***

306)	Infant Love Seat	81/82	Plastic shell may develop cracks. Destroy & replace seat.
------	------------------	-------	---

<i>List #</i>	<i>Manufacturer</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance</i>	
	<b>Model Name</b>		<b>Mfg Date</b>	<b>Problem Type and Consumer Action</b>

**General Motors (continued)**

307) Child Love Seat 3/84-11/84 Plastic shell may develop cracks. Destroy & replace seat.

**Gerry**

**Contact Evenflo: 800-525-2472 / 800-233-5921**

308) Guardian 01/90-05/90 Buckle. Call mfg. for repair info.

309) Secure Ride 626 08/94-03-95 Air bag label. Call mfg. for new label

**Graco**

**800-345-4109 / www.gracobaby.com**

310) GT 1000 1/85-1/86 Crash test failure. Call mfg. for repair info.

**International**

**ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE**

311) Astroseat 12/80-7/81 Buckle. Destroy & replace seat.

**Kolcraft**

**800-453-7673 / 312-247-4494**

312) Automate	180-600, 180-601	Pre 4/93	Buckle. Call mfg. for repair info.
313) Carter Travel 5	13833, 13842, 13852	5/96-9/96	Crash test failure of buckle. Call mfg. for repair info.
314) Dial-A-Fit	180-200, 180-300	1/87-8/89	Upholstery clips. Call mfg. for repair info.
315) Dial-A-Fit	180-200, 180-300	10/88-8/89	Crash test failure. Call mfg. for repair info.
316) Dial-A-Fit II	180-600	11/90-8/91	Crash test failure. Call mfg. for repair info.
317) Infant Rider	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
318) Flip 'N' Go	19127 thru 19130	1/85-3/87	Shield. Call mfg. for repair info.
319) Flip 'N' Go II	19127	1/85-3/88	Shield. Call mfg. for repair info.
320) Perfect Fitt	180-100, 180-150	Pre 4/90	Upholstery clips. Call mfg. for repair info.
321) Perfect Fitt	180-150, 180-200	3/89-10/90	Crash test failure. Call mfg. for repair info.
322) Perfect Fitt	180-200	Pre 10/90	Upholstery. Call mfg. for repair info.
323) Performa		3/96-10-96	Upholstery. Call mfg. for repair info.
324) Performa		1/96-7/97	Buckle release force. Call mfg. for repair info.
325) Playskool Car Seat	140-155, 180-400	12/89-8/90	Upholstery. Call mfg. for repair info.
326) Playskool Car Seat	77001, 77002	1/91-6/93	Buckle. Call mfg. for repair info.
327) Plus 4	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
328) Plus 5	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
329) Plus 5	13833, 13842, 13852	5/96-9/96	Crash test failure of buckle. Call mfg. for repair info.
330) Rock 'N' Ride	13123	2/85-6/85	Plastic shell. Call mfg. to replace seat.
331) Rock 'N' Ride	131-101	Pre 3/90	Upholstery clips. Call mfg. for repair info.
332) Secure Fit		1/96-7/97	Buckle release force. Call mfg. for repair info.
333) Travel About	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
334) Travel About	13833, 13842, 13852	5/96-9/96	Crash test failure of buckle. Call mfg. for repair info.
335) Traveler 700	All	11/01/94-12/31/95	Voluntary action: Buckle concerns. Call mfg. for repair info.
336) Traveler 700	150-100	1/91-8/91	Cracks in plastic. Call mfg. to replace seat.
337) Traveler 700	All	1/91-6/93	Rusting of buckle. Call mfg. for repair info.

<i>List #</i>	<i>Manufacturer</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance</i>	
	<i>Model Name</i>		<i>Mfg Date</i>	<i>Problem Type and Consumer Action</i>

***Lin Lih/MCP Ent.******ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE***

338)	Lin Lih		ALL	Counterfeit seat. Call NHTSA: 800-424-9393
339)	Lin Lih	180-200, 180-300	10/88-8/89	Crash test failure. Call NHTSA: 800-424-9394

***Playskool******Contact Kolcraft: 800-453-7673***

340)	Car Seat	140-155, 180-400	12/89-8/90	Upholstery. Call Kolcraft
341)	Car Seat	77001, 77002	1/91-6/93	Buckle. Call Kolcraft

***Pride Trimble/Virco******800-521-5198***

342)	Click-n-Go	890, 891, 892	2/86-10/87	Crash test failure. Call mfg. to replace seat.
343)	Click-n-Go	890, 891, 892	1/88-4/89	Crash test failure. Call mfg. to replace seat.
344)	Pride Ride	832	1/88-4/89	Crash test failure. Call mfg. to replace seat.

***Questor******Contact Evenflo: 800-233-5921***

345)	Kantwet Car Seat		5/69-3/73	May pinch child's fingers. Call mfg. for repair info.
------	------------------	--	-----------	---

***Renolux (FBS)******ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE***

346)	GT 1000		8/88-10/88	Buckle/recline angle. Destroy & replace seat.
347)	GT 2000		8/88-10/88	Buckle/recline angle. Destroy & replace seat.
348)	GT 2000		1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
349)	GT 2000		5/89-6/93	Flammability of upholstery. Destroy & replace seat.
350)	GT 4000		1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
351)	GT 4000		5/89-6-93	Flammability of upholstery. Destroy & replace seat.
352)	GT 5000		1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
353)	GT 5000		5/89-6-93	Flammability of upholstery. Destroy & replace seat.
354)	GT 5000 Turn A Tot		2/90-4/91	Test failure/upholstery. Destroy & replace seat.
355)	GT 5000 Turn A Tot		1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
356)	GT 5000 Turn A Tot		5/89-6-93	Flammability of upholstery. Destroy & replace seat.
357)	GT 5500		1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
358)	GT 5500		5/89-6-93	Flammability of upholstery. Destroy & replace seat.
359)	GT 7000		All	Remote may overheat/ fire hazard. Destroy & replace seat.
360)	GT 7000		1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
361)	GT 7000		5/89-6-93	Flammability of upholstery. Destroy & replace seat.

***Safeline Kids******800-829-1625******www.tripleplayproducts.com***

362)	Sit'n'Stroll	3240	6/9/97-8/9/97	Air bag labels. The air bag warning label was omitted from the seat cover. Contact Mfg. for new seat cover that has the required air bag warning label.
------	--------------	------	---------------	---

<i>List #</i>	<i>Manufacturer</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance</i>	
	Model Name		Mfg Date	Problem Type and Consumer Action

***Strolee******ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE***

363) Wee Care	All	Pre 4/80	Crash test failure. Destroy & replace seat.
364) Wee Care	599	12/80-5/81	Upholstery. Destroy & replace seat.
365) Wee Care	609, 610	ALL	Plastic shell. Destroy & replace seat.
366) Quick Click	605	ALL	Plastic shell. Destroy & replace seat.
367) GT 3000		87/88	Crash test failure. Destroy & replace seat.

***TRW******ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE***

368) Infant Love Seat		81/82	Plastic shell may develop cracks. Destroy & replace seat.
369) Child Love Seat		3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.

***Volvo******800-458-1552 / 800-221-9136 / 201-768-7300***

370) ALL SEATS		Thru 12/88	Buckle. Call mfg. for refund info.
----------------	--	------------	------------------------------------

